


Carbon Monoxide (CO) and Carbon Dioxide (CO₂) Meter With Air Temp/RH Measurements and Dew Point/Wet Bulb calculations

Model CO260

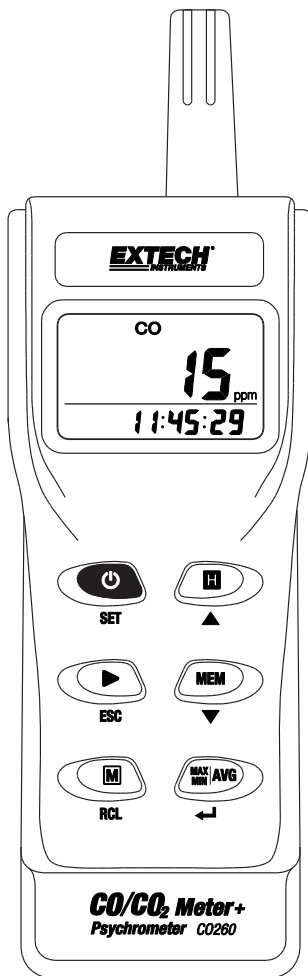

Introduction

Thank you for selecting the Extech CO260 Meter. The CO260 measures CO₂ (Carbon Dioxide) levels, CO (Carbon Monoxide) levels, air temperature, and relative humidity. The CO260 also displays dew point and wet bulb temperatures, generated from calculations performed on temperature and humidity measurements. The CO260 is an ideal instrument for indoor air quality (IAQ) analysis.

This device is shipped fully tested and calibrated and, with proper use, will provide years of reliable service. Please visit our website (www.extech.com) to check for the latest version and translations of this User Manual, Product Updates, and Customer Support.

Features

- Adjustable carbon monoxide warning level
- Designed with NDIR (non-dispersive infrared)
- Long life electrochemical sensor
- Audible and visual alarm
- Backlit LCD for easy viewing in dimly lit areas
- Low battery indicator
- Auto power off
- Mini USB connector
- Manual and automatic recording

Safety Information

IMPORTANT CARBON DIOXIDE (CO) SAFETY NOTES

- The CO260 Carbon Monoxide Monitor is intended for general purpose Air Quality monitoring only, and has not been certified for use pursuant to any state or city safety Carbon Monoxide Alarm or Monitoring requirements.
- The CO260 Carbon Monoxide Monitor has not been tested by an independent lab to comply with the UL 2034 or IAS 6-96 standard.
- It is the responsibility of the customer to obtain and apply current local, state, and national regulations with regard to CO alarms, monitoring and testing.
- Electromagnetic (EMI) interference may cause erratic meter readings; do not place meter near areas of high EMI when taking CO measurements.
- Recovery time is required after the meter has been exposed to high levels of CO; the longer the exposure, the longer the recovery time.



Carbon monoxide is life threatening even at relatively low concentrations; learn and recognize the effects of CO poisoning (see Table below). Do not use this meter as a personal safety-monitoring device.

Effects of Carbon Monoxide (CO) poisoning

Warning: Ensure that the meter is powered, at room temperature, and in an area free of Carbon Monoxide (CO) before starting measurements. If not, the meter will read incorrectly when subsequently measuring CO.

0-1 PPM	Normal background levels
9 PPM	Maximum allowable short term exposure
50 PPM	Maximum allowable continuous exposure level in any 8-hour period, according to OSHA
200 PPM	Mild headache, fatigue, nausea and dizziness after 2-3 hours
400 PPM	Frontal headache with 1-2 hours, life threatening after 3 hours
800 PPM	Dizziness, nausea, convulsions within 45 minutes. Unconsciousness within 2 hours. DEATH WITHIN 2 TO 3 HOURS
1600 PPM	Headache, dizziness, nausea within 20 minutes, DEATH WITHIN 1 HOUR
3200 PPM	Headache, dizziness, nausea within 5-10 minutes. DEATH WITHIN 25-30 MINUTES
6400 PPM	Headache, dizziness, nausea within 1-2 minutes. DEATH WITHIN 10-15 MINUTES
12800 PPM	DEATH WITHIN 1 TO 3 MINUTES

Regulatory exposure limits for Carbon Dioxide (CO₂)

ASHRAE Standard 62-1989: 1000ppm: CO₂ concentration in occupied building should not exceed 1000ppm.

OSHA: 5000ppm: Time weighted average over five 8-hour workday should not exceed 5000ppm.

Building bulletin 101 (BB101): 1500ppm. UK standards for schools state that CO₂ averaged over the whole day (i.e. 9:00am to 3:30 pm) should not exceed 1500ppm.

Germany, Japan, Australia, UK: 5000ppm, 8 hours weighted average in occupational exposure limit is 5000ppm.


EPA Taiwan (Type 1): Indoor areas such as department stores, theaters, restaurants, libraries have acceptable CO₂ concentration of 1000ppm over an 8-hour average period.

EPA Taiwan (Type 2): Indoor areas with special requirements for good air quality such as schools, hospitals, and day care centers have suggested CO₂ level of 600ppm.


Descriptions

METER

1. Temperature and Humidity sensor
 2. Primary display
 3. Secondary display
 4. Power and Set button
 5. Start and Escape button
 6. Mode and Recall button
 7. Min-Max-Avg and Enter button
 8. Memory and Down button
 9. CO and CO₂ sensors (on rear of meter)
 10. Hold and Up button
 11. AC Adaptor and Micro USB ports
- Battery compartment on rear of meter

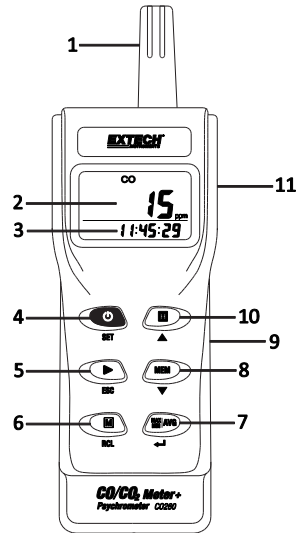



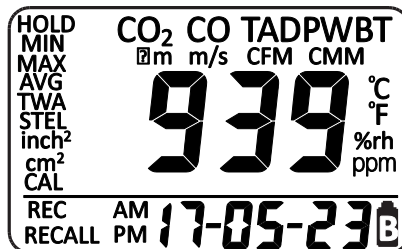





LCD DISPLAY




LCD SYMBOLS

CO ₂	Carbon dioxide
CO	Carbon monoxide
TWA	Time weighted average (8 hours)
STEL	Short-term exposure limit (15 minutes weighted average)
HOLD	Freezes current reading on display
MIN/MAX	Minimum/Maximum readings
	Low battery indicator
DP	Dew point temperature
TA	Air temperature
WBT	Wet bulb temperature
%RH	Relative humidity
C or F	Celsius/Fahrenheit
CAL	Calibration Mode
REC	Manual/automatic data logging
RECALL	View manually logged data

KEYPAD

	<p>Power ON/OFF, SET Short press to power the Meter ON or OFF With the meter OFF, long press to enter setup mode Long press /SET and H/▲ to enable or disable APO mode</p>
	<p>START/ESCAPE Short press to exit setup mode Long press to begin data logging</p>
	<p>MODE/RECALL Short press to change the display modes Long press to recall manually stored readings</p>
	<p>HOLD/UP ARROW Short press to freeze or unfreeze reading on the display Short press while in setup mode to select units or increase the value Long press /SET and H/▲ to enable or disable APO mode</p>
	<p>MEMORY/DOWN ARROW Short press to save readings into memory Short press in setup mode to select units or decrease the value</p>
	<p>MIN/MAX/AVG/TWA/STEL, SAVE Short press to select MIN, MAX, TWA, STEL function Short press in setup mode to save settings</p>

Battery Installation

- Four (4) 'AA' batteries or an AC/DC adaptor powers the meter.
- Install the batteries into the rear battery compartment observing correct polarity.
- When the adaptor is used, the batteries are disconnected from the meter circuitry. The adaptor cannot be used to charge rechargeable batteries.
- When battery voltage is low, the battery symbol () appears. Replace the batteries promptly.



Never dispose of used batteries or rechargeable batteries in household waste.

As consumers, users are legally required to take used batteries to appropriate collection sites, the retail store where the batteries were purchased, or wherever batteries are sold.

Disposal: Do not dispose of this instrument in household waste. The user is obligated to take end-of-life devices to a designated collection point for the disposal of electrical and electronic equipment.

Powering the Meter

Short press the **⏵/SET** button to turn the meter ON or OFF. At power up, the meter emits a short beep and performs a 30-second warmup before entering normal operating mode. After the countdown, the primary LCD will display the current readings. The secondary display will alternate between the current date and time.

Taking Measurements

The meter begins measuring in the selected mode, when powered on, and the sensor responds every 1 second. If the operating environment changes (example: from high to low temperature), it requires 30 seconds for the CO₂ sensor to respond and up to 30 minutes for the relative humidity sensor to respond.

Measuring Carbon Dioxide (CO₂)

1. Short press the **M/REL** button to change the mode to CO₂ if necessary.
2. To take a measurement, trace the CO260 around the area of the suspected leak.
3. The meter indicates the presence of carbon dioxide (CO₂) in ppm in the primary display. The secondary display indicates the current date and time alternately.

NOTE: Do not hold the meter close to your mouth or any other source of CO₂.

Measuring Carbon Monoxide (CO)

1. Short press the **M/REL** button to change the mode to CO, if necessary.
2. To take a measurement, trace the CO260 around the area of the suspected leak.
3. The meter indicates the presence of carbon monoxide (CO) in ppm in the primary display. The secondary display indicates the current date and time alternately.
4. The display will flash and an audible beeper sounds at 25 ppm alerting the user to dangerous CO levels. The higher the concentration of CO, the faster the beeper will sound. The display will stop flashing once the measured CO is below the alarm limit value.

Measuring Air Temperature and Calculating Dew point and Wet bulb

1. Short press the **M/REL** button to change the mode to air, dew point, or wet bulb temperature.
2. To take a measurement, trace the CO260 in the testing area.
3. The primary display indicates the air temperature, dew point, or wet bulb temperature depending on the selected mode. The secondary display indicates the current date and time alternately.
4. Note that Dew Point and Wet Bulb Temperature displays are calculations made from Air Temperature and Relative Humidity measurements.

Measuring Relative Humidity %

1. Short press the **M/REL** button, if necessary, to change the mode to Relative Humidity.
2. To take a measurement, place the CO260 in the testing area.
3. The primary display indicates the relative humidity measurement and the secondary display indicates the current date and time alternately.

Advanced Functions

Data Hold

Short press the **H/▲** button to freeze the readings on the display. The "HOLD" icon flashes in the top left of the display. Short press the **H/▲** button again to unfreeze the readings on the display.

Note: the HOLD function is not operational in Min/Max/Avg mode.

Display Backlight

The meter is equipped with a backlight for easy viewing in dimly lit areas. The backlight will activate for 10 seconds by pressing any button.

MIN, MAX, STEL, TWA Recording

In normal operating mode, short press the **MXMN/AV/←** button to view the minimum, maximum, weighted average, and current readings. With each short press of the **MXMN/AV/←** button, the meter displays the MIN, MAX, STEL, TWA, or current value along with elapsed timer, in sequence. Short press the **▶/ESC** button to return to normal operating mode.

In MIN and MAX modes, the meter shows the lowest (minimum) or highest (maximum) reading in the primary display.

In STEL and TWA modes, the main display shows the weighted average of readings for the past 15 minutes (STEL) or 8 hours (TWA). TWA and STEL mode are only operational in CO₂ mode.

In CURRENT mode, the primary display shows the current readings. The secondary display shows the elapsed timer. Press the **▶/ESC** button to exit and return to normal operating mode.

NOTES:

1. If the meter is ON for < 15 minutes, the STEL value will be the weighted average of readings taken since power on. Similarly, for the TWA mode when the meter has been ON for < 8 hours, the display only shows a weighted average of the readings up to the moment.
2. The CO260 requires at least 5 minutes calculating STEL and TWA. The display shows "----" during the first 5 minutes from power ON.
3. While in HOLD mode, the STEL and TWA values will continue to update every 5 minutes.
4. Hold, Record, and Recall functions are not operational while in Min/Max/Avg mode.
5. TWA and STEL will function only in CO₂ mode
6. The unit of measure can be changed while in Min/Max mode.

Manual Data Recording

The CO260 has 99 memory locations for which to store readings one at a time.

1. While in normal operating mode or hold mode, short press the **MEM/▼** button to store a reading. The REC icon flashes on the display for approximately 3 seconds. The primary display briefly shows the memory location.
2. Each measurement parameter is saved, not just the currently displayed parameter. (For example, when recording CO readings, the CO₂, %RH, and air temperature will also be recorded).

3. Short press the **H/▲** button to freeze the readings on the display before recording the data if the readings change too quickly.

Note: The manual recording mode is not operational in Min/Max mode.

Recalling Manually Stored Readings

The meter can recall up to 99 previously saved readings.

1. While in normal operating mode, long press the **M/REL** button until 'Recall' flashes on the display.
2. Short press the **H/▲** or **MEM/▼** buttons to scroll through the memory locations. The selected memory location will flash for approximately 3 seconds and then the stored reading will display on the screen.
3. Short press the **M/REL** button to change the displayed measurement parameter.
4. The secondary display shows the time and date the data was recorded into memory.
5. To exit memory recall mode, short press the **▶/ESC** button.

Automatic Datalogging

The CO260 automatically records CO₂, CO, Temperature, or RH readings and can store up to 32,000 records. The sample rate can be set from 1 second to 4 hours 59 minutes and 59 seconds. See 'Setup Mode' for information on setting the sample rate.

1. After the sample rate is selected, long press the **▶/ESC** button to begin logging. The 'rec' icon flashes and the primary display shows the real time value. The secondary display shows the current time and date alternately.
2. Short press the **M/REL** button to select a different measurement mode to record.
3. To exit the datalogger mode, long press the **▶/ESC** button. The 'rec' icon stops flashing.

Notes:

Previous records are overwritten any time logging is started.

The **M/REL** button is the only button that is operational while in datalogging mode.

CO Alarm

The meter features an audible alarm (80db beep) that warns when CO concentration exceeds the set limit. The beeper stops when the readings fall below the limit. The meter beeps again if the value exceeds the limit. See the section 'Setup Mode' for more information.

Auto Power OFF

The meter turns off automatically after 20 minutes of inactivity. To override the function, long press both the **U/SET** and **H/▲** buttons while powering ON the meter until "n" appears in the display.

NOTE: Auto power off is not operational while in calibration mode.

Setup Mode

While the meter is OFF, long press the **U/SET** button to enter the setup mode.
To exit the setup mode, short press the **▶/ESC** button at any time during setup.

P10 Clearing the Manual Recording Memory

Clearing the memory will erase **ALL** the manually stored records.

1. Upon entering setup mode, P10 and “CLr” display on the LCD.
2. Short press the **MXMN/AV/↵** button to advance to P11 and make a selection.
3. Short press the **H/▲** or **MEM/▼** button to select YES or NO. ‘YES’ will erase all the manually stored records.
4. Short press the **MXMN/AV/↵** button to save the selection and return to P10.
5. Short press the **▶/ESC** button to exit without saving.
6. Short press the **H/▲** button to advance to the next step.

P20 Setting the CO Alarm

1. When in alarm setup mode, P20 and “ALAR” are displayed. Short press the **H/▲** button to advance to P20 if necessary.
2. Short press the **MXMN/AV/↵** button to advance to P21 and set the CO alarm threshold. The current set value will blink on the display.
3. Short press the **H/▲** button to increase or the **MEM/▼** button to decrease the value. The alarm range is from 15 to 200ppm and each press of the buttons will advance 5ppm.
4. Short press the **MXMN/AV/↵** button to save the selection and return to P20.
5. Short press the **▶/ESC** button to exit without saving.
6. Short press the **H/▲** button to advance to the next step.

P30 Changing the Temperature Units

1. When in temperature setup mode, P30 and “unit” display on the LCD. Short press the **H/▲** button to advance to P30 if necessary.
2. Short press the **MXMN/AV/↵** button to advance to P31 and change the temperature units. The current temperature unit displays on the LCD.
3. Short press the **H/▲** or **MEM/▼** button to toggle between °C and °F.
4. Short press the **MXMN/AV/↵** button to save the setting and return to P30.
5. Short press the **▶/ESC** button to exit without saving.
6. Short press the **H/▲** button to advance to the next step.

P40 Setting the Datalogging Sampling Rate

1. When in datalogging setup mode, P40 and “rAtE” display on the LCD. Short press the **H/▲** button to advance to P40 if necessary.
2. Short press the **MXMN/AV/↵** button to advance to set the sampling rate for datalogging. The **hour** digit will blink in the secondary display.
3. Short press the **H/▲** button to increase the time or short press the **MEM/▼** button to decrease the time.
4. Short press the **MXMN/AV/↵** button to save the setting and advance to the **minute** setup.

5. Short press the **H/▲** button to increase the time or short press the **MEM/▼** button to decrease the time.
6. Short press the **MXMN/AV/↵** button to save the setting and advance to the **second** setup.
7. Short press the **MXMN/AV/↵** button to save the settings and return to P40.
8. Short press the **►/ESC** button to exit without saving.
9. Short press the **H/▲** button to advance to the next step.

Note: The datalogging sampling range is from 1 second to 4 hours 59 minutes 59 seconds.

P50 Changing the Barometric Pressure Compensation

1. When in pressure setup mode, P50 and “PrES” display on the LCD. Short press the **H/▲** button to advance to P50 if necessary.
2. Short press the **MXMN/AV/↵** button to set the pressure compensation value for the CO₂ measurement. The current pressure compensation value in hPa will flash on the LCD.
3. Short press the **H/▲** or **MEM/▼** button to adjust the barometric pressure value. The pressure compensation range is from 70 to 199 hPa.
4. Short press the **MXMN/AV/↵** button to save the setting and return to P50.
5. Short press the **►/ESC** button to exit without saving.
6. Short press the **H/▲** button to advance to the next step.

P60 Setting the Real-Time Clock

1. When in Real-Time Clock mode, P60 and “rtC” display on the LCD. Short press the **H/▲** button to advance to P60 if necessary.
2. Short press the **MXMN/AV/↵** button to advance to P61 and set the time as 12-hour or 24-hour format. The current time format will flash on the LCD.
3. Short press the **H/▲** or **MEM/▼** button to change the format between 12-hour and 24-hour.
4. Short press the **MXMN/AV/↵** button to save the setting and advance.
5. The **year** will flash in the secondary display. Short press the **H/▲** or **MEM/▼** button to change the value.
6. Short press the **MXMN/AV/↵** button to save the setting and advance to the **month** setup.
7. Short press the **H/▲** or **MEM/▼** button to change the value.
8. Short press the **MXMN/AV/↵** button to save the setting and advance to the next step.
9. Repeat the above steps to complete the setup for the **month/day/hour/minute/second** settings.
10. Short press the **MXMN/AV/↵** button to save the selection and return to P60.
11. Short press the **►/ESC** button to exit setup mode.

Calibration

RH CALIBRATION

The meter is calibrated to a standard 33% and 75% salt solution bottle. Calibration must be performed in a controlled temperature environment of 25°C.

CAUTION: Do not calibrate the humidity without the default calibration salts. The meter will lose its current calibration data and will become inoperable. Contact Extech to order calibration salts or to inquire about calibration services.

33% Calibration

1. Plug the sensor probe into the 33% salt bottle.
2. Long press the ►/ESC , MEM/▼ and ⏻/SET buttons simultaneously to enter calibration mode.
3. In calibration mode, "CAL" and the current value (32.8% if at 25°C) will blink on the LCD.
4. The meter is now calibrating, and will finish in about 60 minutes, when the current value stops blinking. "CAL" will continue to blink on the display.
5. To abort the calibration, power the meter OFF at any time.

75% calibration

1. After the 33% calibration, plug the sensor probe into a 75% salt bottle.
2. Long press the MXMN/AV/↵ button to enter 75% calibration.
3. "CAL" and current value (75.3% if at 25°C) will blink on the LCD.
4. The meter is now calibrating. The calibration is complete in about 60 minutes. The values will stop flashing and the meter powers OFF automatically when calibration is complete.
5. To abort the calibration, power OFF the meter at any time.

PC Software

This meter has the capability to connect to and communicate with a PC.

Check the software download page of the website www.extech.com/software/downloads for the latest version of the PC software and its operating system compatibility.

Download and unzip the software. Run ExtechInstaller.exe and then refer to the instructions provided in the HELP Utility within the software program.

Specifications

Function	Range	Resolution	Accuracy
CO ₂	0 to 5000ppm	1 ppm	±(5%rdg + 30ppm)
	5001 to 9999ppm	1 ppm	Not specified
	Pressure dependence: +1.6% of reading per kPa deviation from normal pressure (100kPa)		
CO	<100 ppm	1 ppm	±(10ppm)
	101 to 500 ppm	1 ppm	±(10%rdg)
	501 to 1000 ppm	1 ppm	±(20%rdg)
Temperature	-20 to 60°C	0.1°	±0.6°C
	-5 to 140°F	0.1°	±0.9°F
Humidity	0.1 to 99.9%	0.1%RH	±3%(10 to 90%) @25°C ±5%(all other ranges)@25°C
Wet Bulb	-5 to 59.9°C 23 to 140°F	0.1°	Calculated from RH and Temperature
Dew Point	-20 to 59.9°C -4 to 140°F	0.1°	

Display	LCD with backlight
Display size	1.0 x 1.7" (26 x 44 mm)
Warm-up period	30 seconds
Response Time	CO ₂ : <30 seconds (90% step change) CO: <60 seconds (90% step change) Tair: <2 minutes (90% step change) RH: <10 minutes (90% step change)
Sensor Type	CO ₂ : NDIR (non-dispersive infrared) technology Humidity: Capacitance sensor Temperature (air): Thermistor
Operating Conditions	-4 to 122°F (-20 to 50°C) CO ₂ sensor 32 to 122°F (0 to 50°C) CO sensor -4 to 122 °F (-20 to 50°C) all other parameters
Storage Conditions	-4 to 140°F (-20 to 60°C); 10 to 90% RH non-condensing
Power Supply	4 x 1.5V 'AA' batteries or AC adaptor (9V)
Battery Life	approx. 24 hours (alkaline batteries)
Dimensions / Weight	8.1 x 2.8 x 2.2" (205 x 70 x 56mm) / 7.1 oz. (200g)

Troubleshooting

Error	Problem	Solution
Display	No display when pressing power button	Ensure that batteries are properly installed with correct polarity
		Press and hold power button to retry
		Replace batteries
		Open the battery compartment and using a small metal tip, press the reset button
Display	Readings frozen on display	Check to see if data hold function is activated. Press hold to deactivate.
Display	Slow Response	Check for air flow blockage to sensors
E01/E33	CO ₂ sensor is not working	Replace the battery
E02	Measurement is below the range of the meter	Check readings in a different area
E03	Measurement is above the range of the meter	Check readings in a different area
E04	Data error	Contact Extech for service
E11	Humidity calibration Error	Retry humidity calibration
E16	CO calibration error	Contact Extech for service
E31	A/D or temperature sensor failure	Contact Extech for service
E32	Memory failure	Contact Extech for service
E33	A/D or humidity sensor failure	Contact Extech for service
E33	Measurement circuit failure	Contact Extech for service

Maintenance

CLEANING AND STORAGE

1. Clean the meter with a damp cloth and mild detergent when necessary. Do not use solvents or abrasives.
2. Store the meter in an area with moderate temperature and humidity (refer to the operating and storage temperature ranges in the specifications section).

Two-year Warranty

Teledyne FLIR warrants this Extech brand instrument to be free of defects in parts and workmanship for **two years from date of shipment (a six-month limited warranty applies to sensors and cables). To view the full warranty text please visit:**
<http://www.extech.com/support/warranties>.

Calibration and Repair Services

Teledyne FLIR offers calibration and repair services for the Extech brand products we sell. We offer NIST traceable calibration for most of our products. Contact us for information on calibration and repair availability, refer to the contact information below. Annual calibrations should be performed to verify meter performance and accuracy. Product specifications are subject to change without notice. Please visit our website for the most up-to-date product information:
www.extech.com.

Contact Customer Support

Customer Support Telephone List: <https://support.flir.com/contact>

Calibration, Repair, and Returns: repair@extech.com

Technical Support: <https://support.flir.com>

Copyright © 2022 Teledyne FLIR Commercial Systems, Inc.

All rights reserved including the right of reproduction in whole or in part in any form
www.extech.com

This document does not contain any export-controlled information